

New Hampshire Volunteer Lake Assessment Program

2003 Interim Report for Loon Lake Plymouth



NHDES
Water Division
Watershed Management Bureau
29 Hazen Drive
Concord, NH 03301



OBSERVATIONS & RECOMMENDATIONS

After reviewing data collected from **LOON LAKE, PLYMOUTH**, the program coordinators have made the following observations and recommendations:

FIGURE INTERPRETATION

- **Figure 1 and Table 1:** The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the lake/pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a, and are naturally found in lake ecosystems, the chlorophyll-a concentration measured in the water gives an estimation of the algal concentration or lake productivity. **The mean (average) summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 7.02 mg/m³.**

The current year data (the top graph) show that the chlorophyll-a concentration **decreased** from June to July, and then **increased** from July to August. The chlorophyll-a concentration in August was **greater than** the state mean.

The historical data (the bottom graph) show that the 2003 chlorophyll-a mean is **less than** the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows a **variable** in-lake chlorophyll-a trend, meaning that the concentration has **fluctuated, but has not continually increased or decreased**, since monitoring began in 1989. In the 2004 annual report, we will conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration since monitoring began.

While algae are naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Algal concentrations may increase with an increase in nonpoint sources of phosphorus loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). Therefore, it is extremely important for volunteer monitors to continually educate residents about how activities within the watershed can affect phosphorus loading and lake/pond quality.

- **Figure 2 and Table 3:** The graphs in Figure 2 (Appendix A) show historical and current year data for lake/pond transparency. Table 3 (Appendix B) lists the maximum, minimum and mean transparency data for each sampling season that the lake/pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. **The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.**

The current year data (the top graph) show that the in-lake transparency **increased** from June to July, and then **decreased** from July to August. The transparency in July was **greater than** state mean.

The historical data (the bottom graph) show that the 2003 mean transparency is **approximately equal to** the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows a **relatively stable** trend for in-lake transparency, meaning that the transparency has **remained approximately equal to the state mean** since monitoring began. As discussed previously, in the 2004 annual report we will conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.

Typically, high intensity rainfall causes erosion of sediments into lakes/ponds and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, lake/pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the lake/pond.

Guides to Best Management Practices designed to reduce, and possibly even eliminate, nonpoint source pollutants, such as sediment loading, are available from DES upon request.

- **Figure 3 and Table 8:** The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the lake/pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a lake/pond can lead to increases in plant and algal growth over time. **The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.**

The current year data for the epilimnion (the top inset graph) show that the phosphorus concentration **decreased** from June to July, and then **increased** from July to August. The phosphorus concentration in June and August was **slightly greater than** the state median.

The current year data for the hypolimnion (the bottom inset graph) show that the phosphorus concentration **decreased** from June to August. The phosphorus concentration in June was **slightly greater than** the state median.

The historical data show that the 2003 mean epilimnetic and hypolimnetic phosphorus concentration is **approximately equal to** the state median.

Overall, visual inspection of the historical data trend line for the epilimnion and the hypolimnion show **a variable, but overall decreasing (meaning improving)**, phosphorus trend since monitoring began in 1989.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands.

TABLE INTERPRETATION**➤ Table 2: Phytoplankton**

Table 2 (Appendix B) lists the current and historic phytoplankton species observed in the lake/pond. The dominant phytoplankton species observed this year were ***Asterionella*, *Rhizosolenia*, and *Tabellaria* (which are all diatoms).**

Phytoplankton populations undergo a natural succession during the growing season (Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding seasonal plankton succession). Diatoms and golden-brown algae are typical in New Hampshire’s less productive lakes and ponds.

➤ Table 2: Cyanobacteria (Blue-green algae)

Small amounts of the cyanobacterium ***Anabaena*** was observed in the plankton sample this season. ***This species, if present in large amounts, can be toxic to livestock, wildlife, pets, and humans.***

Cyanobacteria can reach nuisance levels when excessive nutrients and favorable environmental conditions occur. During September of 2003, a few lakes and ponds in the southern portion of the state experienced cyanobacteria blooms. This was likely due to nutrient loading to these waterbodies. As mentioned previously, many weeks during the Spring and Summer of 2003 were rainy, which likely resulted in a large amount of nutrient loading to surface waters.

The presence of cyanobacteria serves as a reminder of the lake’s/pond’s delicate balance. Watershed residents should continue to act proactively to reduce nutrient loading into the lake/pond by eliminating fertilizer use on lawns, keeping the lake/pond shoreline natural, re-vegetating cleared areas within the watershed, and properly maintaining septic systems and roads.

In addition, residents should also observe the lake/pond in September and October during the time of fall turnover (lake mixing) to document any algal blooms that may occur. Cyanobacteria (blue-green algae) have the ability to regulate their depth in the water column by producing or releasing gas from vesicles. However, occasionally lake mixing can affect their buoyancy and cause them to rise to the surface and bloom. Wind and currents tend to “pile” cyanobacteria into scums that accumulate in one section of the lake/pond. If a fall bloom occurs, please contact the VLAP Coordinator.

➤ **Table 4: pH**

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is **6.5**, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding pH, please refer to the "Chemical Monitoring Parameters" section of this report.

The mean pH at the deep spot this season ranged from **5.99** in the hypolimnion to **6.22** in the epilimnion, which means that the water is **slightly acidic**.

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase lake/pond pH.

➤ **Table 5: Acid Neutralizing Capacity**

Table 5 (Appendix B) presents the current year and historic epilimnetic ANC for each year the lake/pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. The mean ANC value for New Hampshire's lakes and ponds is **6.7 mg/L**, which indicates that many lakes and ponds in the state are "highly sensitive" to acidic inputs. For a more detailed explanation, please refer to the "Chemical Monitoring Parameters" section of this report.

The Acid Neutralizing Capacity (ANC) of the epilimnion (the upper layer) continued to remain ***much less than*** the state mean. Specifically, the mean ANC this season was **2.70 mg/L**, which indicates that the lake is ***highly sensitive*** to acidic inputs (such as acid precipitation).

➤ **Table 6: Conductivity**

Table 6 (Appendix B) presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. The mean conductivity value for New Hampshire's lakes and ponds is

62.1 uMhos/cm. For a more detailed explanation, please refer to the “Chemical Monitoring Parameters” section of this report.

The conductivity at the deep spot in the lake/pond was relatively **low** (approximately 28 uMhos/cm) which is **less than** the state mean. The conductivity at the deep spot has remained **relatively low and stable** since monitoring began in 1989.

However, the conductivity has **slightly increased** in the inlets since monitoring began. Typically, sources of increased conductivity are due to human activity. These activities include septic systems that fail and leak leachate into the groundwater (and eventually into the tributaries and the lake/pond), agricultural runoff, and road runoff (which contains road salt during the spring snow melt). New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could contribute to increasing conductivity. In addition, natural sources, such as iron deposits in bedrock, can influence conductivity.

➤ **Table 8: Total Phosphorus**

Table 8 (Appendix B) presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae’s ability to grow and reproduce. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

The total phosphorus concentration was **elevated** in **Inlet #2** on the July 19 sampling event. This station has had a history of **fluctuating** total phosphorus concentrations. However, the turbidity (Table 11) of the sample was also **elevated**, which suggests that the stream bottom may have been disturbed while sampling or that erosion is occurring in this portion of the watershed.

When the stream bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting samples in the inlets, please be sure to sample where there the stream is flowing and where the stream is deep enough to collect a “clean” sample.

If you suspect that erosion is occurring in this portion of the watershed, we recommend that your monitoring group conduct stream surveys and storm event sampling along this inlet. This additional sampling may allow us to determine what is causing the elevated levels of turbidity and phosphorus.

For a detailed explanation on how to conduct rain event and stream surveys, please refer to the 2002 VLAP Annual Report “Special Topic Article”, or contact the VLAP Coordinator.

➤ **Table 9 and Table 10: Dissolved Oxygen and Temperature Data**

Table 9 (Appendix B) shows the dissolved oxygen/temperature profile(s) for the 2003 sampling season. Table 10 (Appendix B) shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

The dissolved oxygen concentration was **relatively high** at all depths sampled at the deep spot of the lake/pond. As stratified lakes/ponds age, and as the summer progresses, oxygen typically becomes **depleted** in the hypolimnion (lower layer) by the process of decomposition. Specifically, the loss of oxygen in the hypolimnion results primarily from the process of biological oxidation of organic matter (i.e.; biological organisms using oxygen to break down organic matter), both in the water column and particularly at the bottom of the lake/pond where the water meets the sediment.

➤ **Table 11: Turbidity**

Table 11 (Appendix B) lists the current year and historic data for in-lake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to the “Other Monitoring Parameters” section of this report for a more detailed explanation.

The turbidity of the hypolimnion (lower layer) sample was **elevated** on the August 24 sampling event. This suggests that the lake/pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling. When the lake/pond bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting the hypolimnion sample, please check to make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

As discussed previously, the turbidity in **Inlet #2** sample was **elevated** on the July 19 sampling event, which suggests that the stream bottom may have been disturbed while sampling or that erosion is occurring in this portion of the watershed.

➤ **Table 12: Bacteria (*E.coli*)**

Table 12 lists the current year data for bacteria (*E.coli*) testing. *E. coli* is a normal bacterium found in the large intestine of humans and other warm-blooded animals. *E.coli* is used as an indicator organism because it is easily cultured and its presence in the water, in defined amounts, indicates that sewage **MAY** be present. If sewage is present in the water, potentially harmful disease-causing organisms may also be present. Please consult the “Other Monitoring Parameters” section of the report for the current state standards for *E. coli* in surface waters.

The *E.coli* concentration was **low** at the **Inlet #1 Beach** and the **Inlet #2 Beach** on the June 22 sampling event.

If you are concerned about bacteria levels at these beaches, you may want to repeat this test next season on a weekend during heavy beach use or after a rain event. Since *E.coli* die quickly in cool pond waters, testing is most accurate and most representative of the health risk to bathers when the source (humans, animals, or waterfowl) is present.

➤ **Other Observations:**

During the annual DES visit to Loon Lake, the VLAP Coordinator observed a large amount of goose droppings on the sandy and grassy areas that surround the pond. Goose droppings may contribute phosphorus and bacteria to the pond. The management of geese is very difficult, and it appears that the geese are not deterred by the orange fencing surrounding the pond. For additional ideas of how to manage this problem, you may want to consult the following document:

Management of Canada Geese in Suburban Areas: A Guide to the Basics,
Draft Report, NJ Department of Environmental Protection Division of
Watershed Management, March 2001,
www.state.nj.us/dep/watershedmgt/DOCS/BMP_DOCS/Goosedraft.pdf.

DATA QUALITY ASSURANCE AND CONTROL

Annual Assessment Audit:

During the annual visit to your lake/pond, the biologist conducted a “Sampling Procedures Assessment Audit” for your monitoring group. Specifically, the biologist observed the performance of your monitoring group while sampling and filled out an assessment audit sheet to document the ability of the volunteer monitors to follow the proper field

sampling procedures (as outlined in the VLAP Monitor's Field Manual). This assessment is used to identify any aspects of sample collection in which volunteer monitors are not following the proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples that the volunteer monitors collect are truly representative of actual lake and tributary conditions.

Overall, your monitoring group did an **excellent** job collecting samples on the annual biologist visit this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the biologist to provide additional training. Keep up the good work!

Sample Receipt Checklist

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if the volunteer monitors followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, future re-occurrences of improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did a **very good** job when collecting samples this season! Specifically, the members of your monitoring group followed the majority of the proper field sampling procedures when collecting and submitting samples to the laboratory. However, the laboratory did identify one aspect of sample collection that the volunteer monitors should keep in mind:

- **Sample Holding Time:** Please remember to return samples to the laboratory **within 24 hours of sample collection**. This will ensure that samples do not degrade before they are analyzed. If you plan to sample on the weekend, please sample on Sunday, preferably in the afternoon, and return samples to the lab first thing on Monday morning to ensure that samples can be analyzed within 24 hours. ***E.coli*, pH, ANC, and chlorophyll samples that are more than 24 hours old will not be accepted by the laboratory for analysis.**

NOTES

- **Monitor's Note (6/22/03):** Lots of pollen on water surface, overcast conditions, and ripples made it difficult to view Secchi disk.

(7/19/03): 2 heavy rains in the past week: 2.5" of rain. Outlet flowing freely.

➤ **Biologist's Note (7/19/03):** Chlorophyll-a result validity questionable: sample taken over 48 hours previous to being run. Phosphorous level at Mill Brook was elevated.

(8/24/03): Due to laboratory error, there was no Turbidity result for the outlet sample. We apologize for this loss of data.

USEFUL RESOURCES

Acid Deposition Impacting New Hampshire's Ecosystems, ARD-32, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/ard/ard-32.htm.

Best Management Practices to Control Nonpoint Source Pollution: A Guide for Citizens and Town Officials, NHDES-WD 97-8, NHDES Booklet, (603) 271-3503.

Camp Road Maintenance Manual: A Guide for Landowners. Kennebec Soil and Water Conservation District, 1992, (207) 287-3901.

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/wmb/wmb-10.htm.

Erosion Control for Construction in the Protected Shoreland Buffer Zone, WD-SP-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-1.htm

Impacts of Development Upon Stormwater Runoff, WD-WQE-7, NHDES Fact Sheet, (603) 271-3503, or www.des.state.nh.us/factsheets/wqe/wqe-7.htm

Lake Protection Tips: Some Do's and Don'ts for Maintaining Healthy Lakes, WD-BB-9, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-9.htm.

Proper Lawn Care In the Protected Shoreland, The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm.

Road Salt and Water Quality, WD-WMB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/wmb/wmb-4.htm.

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-15.htm.

Swimmers Itch, WD-BB-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-2.htm.

OBSERVATIONS AND RECOMMENDATIONS

2003



Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm.

APPENDIX A

GRAPHS



Loon Lake, Plymouth

Figure 1. Monthly and Historical Chlorophyll-a Results

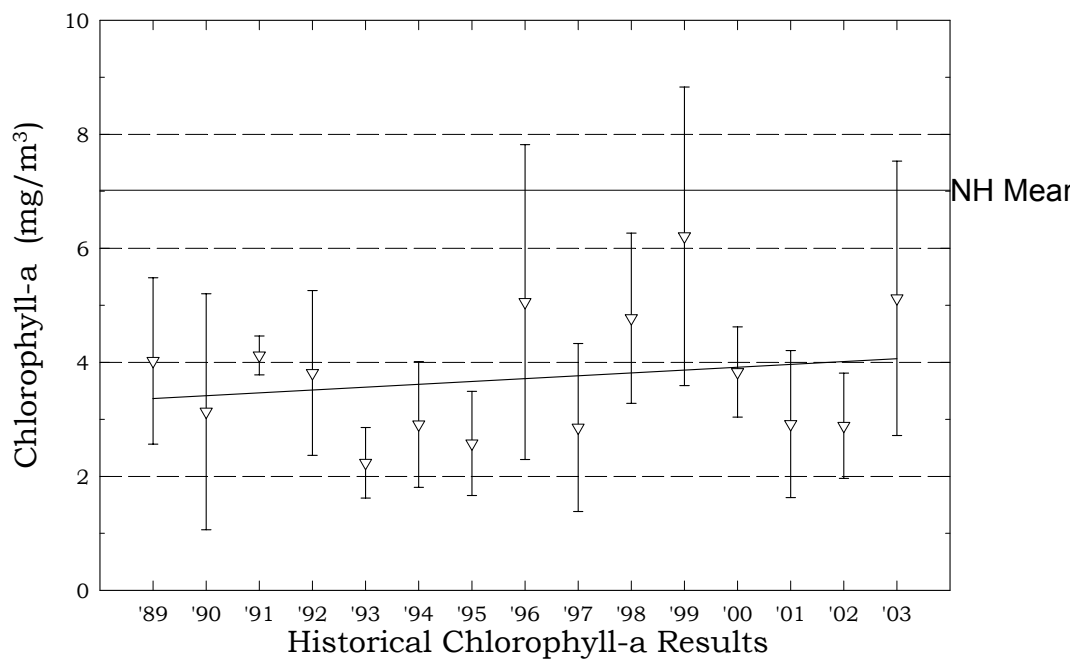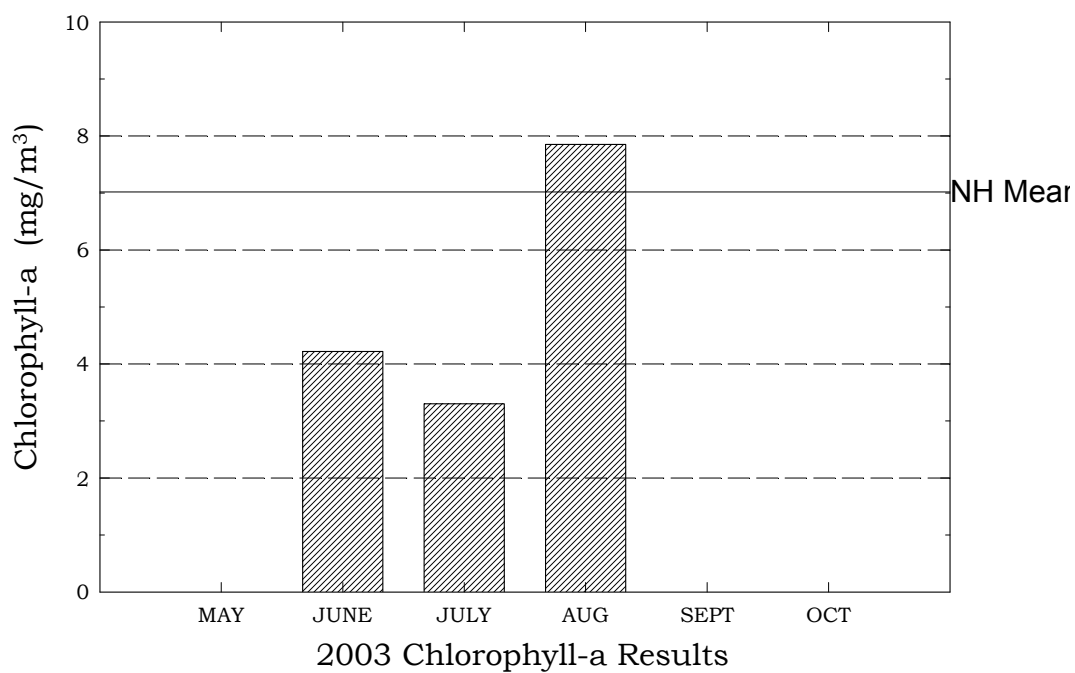

Loon Lake, Plymouth

Figure 2. Monthly and Historical Transparency Results

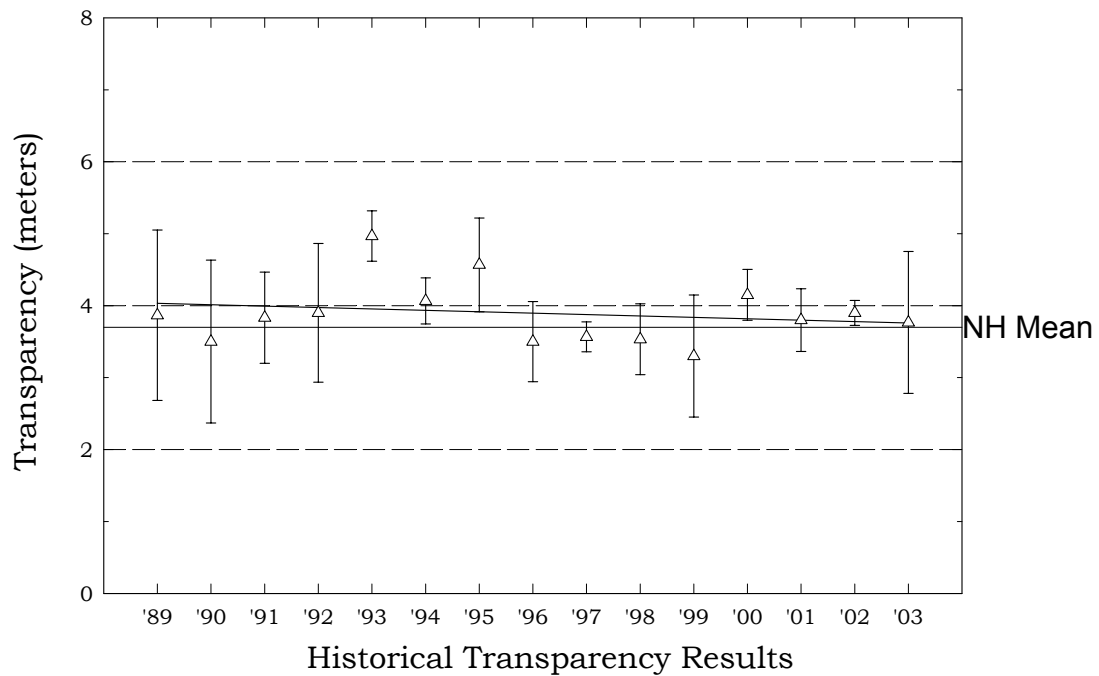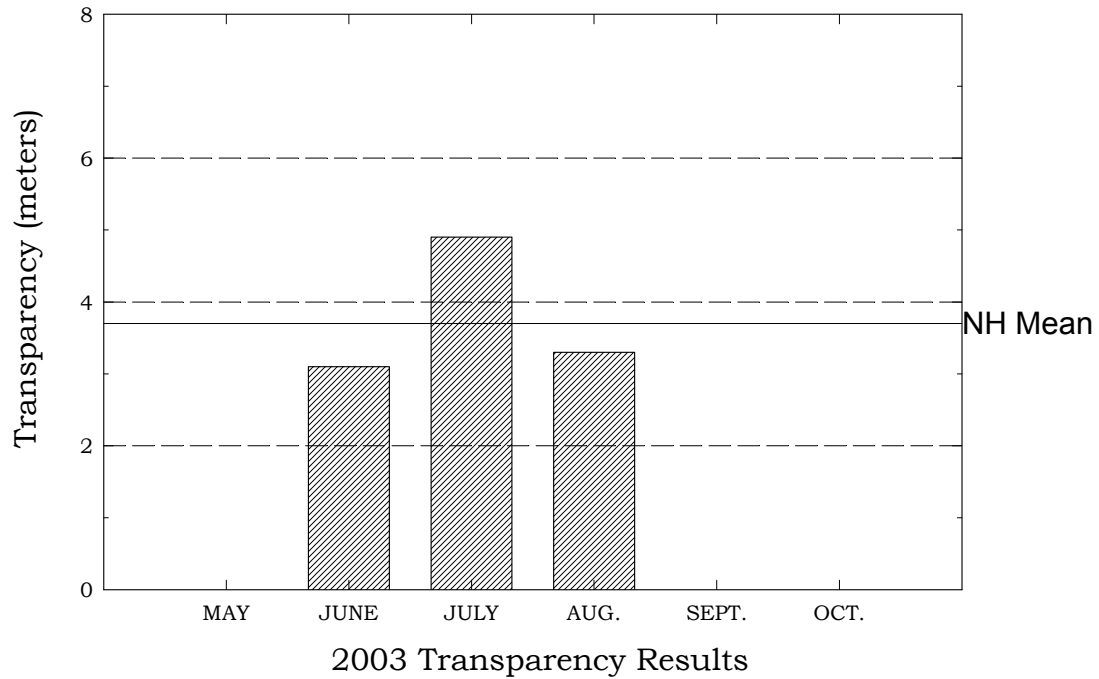

Loon Lake, Plymouth

Figure 3. Monthly and Historical Total Phosphorus Data.

